



Bulletin No.: PIT5899

Published date: N/A

Preliminary Information

PIT5899 Diagnostic Tip for Back-up Camera, Back-up lamps and/or Vanity lamps inoperative

Product Investigation Review Required


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore	2014 - 2019	All	All	All	All
Chevrolet	Trax	2014 - 2019	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UVC
Condition	Some customers may notice that back-up camera, back-up lamps and/or vanity lamps are inoperative. Technicians may find any of the following DTC's B127B, B133B or B2545
Cause	This may be caused by an open fuse F6DA, which could be caused by the headliner harness or vanity lamp harness being pinched at the either LH or RH sunshade mount.

Correction:

Dealers should remove both sunshade assemblies and inspect the headliner or sunshade harnesses for being pinched. If harness is pinched, dealers should perform a wire to wire repair as outline in Service Information.

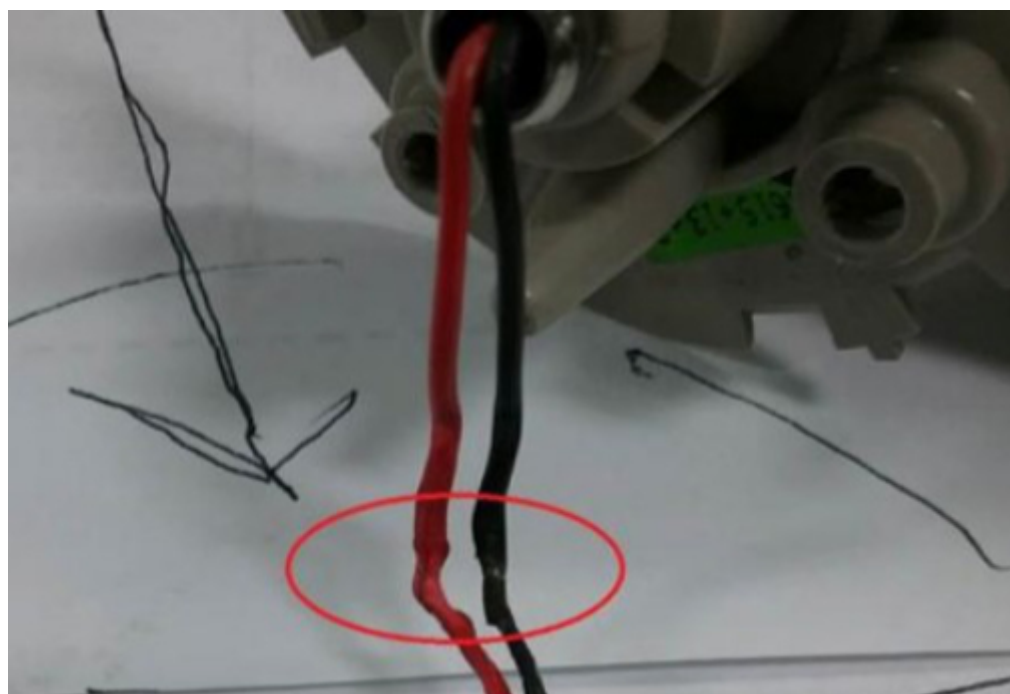



Version History

Version	1
Modified	03/15/2022 - Created on.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.