

# **EchoTREK**

SE/SG-300 and SE/SG-300 Ex 2-wire compact ultrasonic level transmitter family

Installation and Programming manual 19th edition






#### **NIVELCO Process Control Co.**

H-1043 Budapest, Dugonics v. 11.
Tel.: (36-1) 889-0100 Fax: (36-1) 889-0200
E-mail: sales@nivelco.com www.nivelco.com





# **BASIC CONCEPTS AND ELEMENTS**

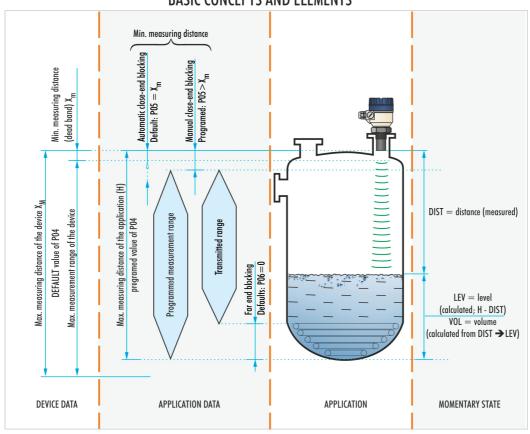

	APPROVALS	Reference document number
€x>	BKI ATEX, Certificate No.: BKI16ATEX0017X/2	sea380hu2118bp
Segurança Segurança INMETRO	INMETRO, Certificate No.:DNV 14.0167 X – Rev. 02	sea3802pk0600p_14
EAC	Ex Russia, Certificate No.: RU C-HU.MF62.B.04399	spa3804m0600p_03



# CONTENTS

1. INTRODUCTION	£
2. ORDER CODES	7
3. TECHNICAL DATA	8
3.1 GENERAL DATA	8
3.2 ADDITIONAL DATA FOR EXPLOSION-PROOF CERTIFIED VERSIONS	
3.3 SPECIAL DATA OF THE TRANSDUCERS	10
3.4 DIMENSIONS	<b>1</b> 1
3.5 ACCESSORIES	
3.6 SPECIAL CONDITIONS OF SAFE USE	
3.7 MAINTENANCE REPAIR, AND STORAGE CONDITIONS	13
3.7.1 Software upgrade	13
4. INSTALLATION	14
4.1 LIQUID LEVEL MEASUREMENT	14
4.2 OPEN CHANNEL FLOW MEASUREMENT	
4.3 INSTALLATION AND ELECTRICAL CONNECTION	
4.4 LOOP CURRENT CHECKING	
5. PROGRAMMING	17
5.1 Programming without Display Module	18
5.2 PROGRAMMING WITH THE SAP-200 DISPLAY MODULE	
5.2.1 SAP-200 display module	
5.2.2 Steps of the SAP-200 display module	22
5.2.3 Indications of the SAP-200 and led status	
5.2.4 QUICKSET	
5.2.5 Full parameter access	26

6. PARAMETERS – DESCRIPTIONS AND PROGRAMMING	28
6.1 MEASUREMENT CONFIGURATION	2
6.2 CURRENT OUTPUT	34
6.3 RELAY OUTPUT	3
6.4 DIGITAL OUTPUT	3
6.5 MEASUREMENT OPTIMISATION	30
6.6 DATA LOGGER	4
6.6.1 Reading data out from the logger	4
6.7 VOLUME MEASUREMENT	
6.8 VOLUME FLOW MEASURING	4
6.9 32- POINT LINEARISATION	
6.10 Informational Parameters (Read Out Parameters)	5
6.11 ADDITIONAL PARAMETERS OF THE FLOW METERING	
6.12 SUPPLEMENTARY PARAMETER OF THE LOGGER	54
6.13 Test parameters	5
6.14 SIMULATION	5
6.15 Access Lock	5
7. ERROR CODES	<b>-</b> -
. ERROR CODES	ɔ
DADAMETER TARLE	
B. PARAMETER TABLE	58
A COUNT VELOCITIES IN DIFFERENT CASES	
). SOUND VELOCITIES IN DIFFERENT GASES	6(

#### Thank you for choosing NIVELCO instrument/

# 1. INTRODUCTION

#### Application

The EchoTREK compact ultrasonic level transmitters from NIVELCO are an excellent tool for the level measurement of liquids.


Level measurement technology based on the non-contacting ultrasonic principle is especially suited for applications where, for any reason, no physical contact can be established to the surface of the material to be measured.

Such reasons may include corrosive attack by the process medium against the measuring device material (acids), possible contamination (sewage) or particles of the process medium adhering to the measuring device (adhesive materials).

#### **Principle of Operation**

The ultrasonic level metering technology is based on the principle of measuring the time required for the ultrasound pulses to make a round trip from the sensor to the level to be measured and back. The sensor emits an ultrasonic pulse train and receives the echoes reflected. The intelligent electronic device processes the received signal by selecting the echo reflected by the surface and calculates from the time of flight the distance between the sensor and the surface which constitutes the basis of all output signals of the EchoTREK.

**A Total beam angle** of 5...7° at –3 dB as is featured by most of NIVELCO's SenSonic transducers ensuring a reliable measurement in narrow silos with uneven side walls as well as in process tanks with various protruding objects. Furthermore, as a result of the narrow beam angle – the emitted ultrasonic signals have an outstanding focusing – deep penetration through gases, vapor and foam is ensured.

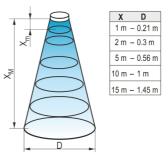

Diameters corresponding to 5° beam angle.

**Dead Band** is a feature common to all ultrasonic level meters.

It is specified as "Minimum measuring distance" in the Technical Data Table. Measurement within this range cannot be interpreted.

**Minimum measuring distance (X<sub>m</sub>)** is determined by the design of the unit within which the measurement is not possible (Dead Zone). This distance can be extended by programming in order to avoid disturbing effects of possible disturbing echoes coming from fixed objects. (Close-end Blocking).

**Maximum measuring distance (X\_M)** is the greatest distance (determined by the design of the unit) which can be measured by the unit under ideal conditions. The maximum measuring distance of the actual application (H) must not be greater than  $X_M$ .

# 2. ORDER CODES

Not all combinations are possible!

EchoTREK S \_\_\_\_ - 3 \_\_\_ - \_\_\_

Түре	CODE
Transmitter	Ε
Transmitter with local indicator	G

HOUSING / TRANSDUCER MATERIAL	CODE
Aluminum (powder-coated) / PP	Α
Aluminum (powder-coated) / PP + foam	D
Aluminum (powder-coated) / PVDF	В
Aluminum (powder-coated) / PTFE	Т
Aluminum (powder-coated) / Stainless steel	S
Plastic, PBT, reinforced fiberglass / PP	Р
Plastic, PBT, reinforced fiberglass / PP + foam	G
Plastic, PBT, reinforced fiberglass / PVDF	٧
Plastic, PBT, reinforced fiberglass / PTFE	F
Plastic, PBT, reinforced fiberglass / Stainless Steel	M
Stainless steel / PP	K
Stainless steel / PVDF	W
Stainless steel / PTFE	L
Stainless Steel / Stainless Steel	N

MEASURING RANGE *	CODE
15; 25 m	2
12; 15 m; 20 m	4
7; 10 m	6
6; 8 m	7
5; 6 m	8
3; 4 m	9

PROCESS CONNECTION	CODE
BSP thread	0
NPT thread	N
DN80 PN16 / PP	2
DN100 PN16 / PP	3
DN125 PN16 / PP	4
DN150 PN16 / PP	5
DN200 PN16 / PP	6
DN250 PN16 / PP	7
DN300 PN16 / PP	8
3" FF 150 psi / PP	Α
4" FF 150 psi / PP	В
5" FF 150 psi / PP	С
6" FF 150 psi / PP	D
8" FF 150 psi / PP	Е
12" FF 150 psi / PP	Y
10K 80 A / PP	G
10K 100 A / PP	Н
200 mm bracket	K
500 mm bracket	L
700 mm bracket	M
10K 125 A / PP	Р
10K 150 A / PP	R
10K 200 A / PP	S
10K 300 A / PP	Z

Оитрит / Ех	CODE
420 mA / LOGGER	1
420 mA	2
420 mA / HART / LOGGER	3
420 mA / HART	4
420 mA / LOGGER / Ex	5
420 mA / Ex	6
420 mA / HART / LOGGER / Ex	7
420 mA / HART / Ex	8
420 mA / LOGGER / Relay	L
420 mA / Relay	R
420 mA / HART /	Α
LOGGER / Relay	A
420 mA / HART / Relay	Н

The order code of an Ex-version should end in "Ex"

<sup>\*</sup> Measuring range depends on the material of the transducer

# 3. TECHNICAL DATA

# 3.1 GENERAL DATA

Туре		S□P-3□□-□, S□A-3□□-□, S□K-3□□-□	S□V-3□□-□, S□B-3□□-□, S□W-3□□-□, S□F-3□□-□, S□T-3□□-□, S□L-3□□-□	S□S-3□□-□, S□M-3□□-□, S□N-3□□-□		
Transducer materials		PP	PVDF / PTFE	Stainless steel		
Housing mate	rial	Fiber	rglass plastic PBT; Powder-coated aluminum, Stainl	ess steel		
Process temperature		−30+90 °C (−20190 °F)		-30+100 °C (-20210 °F) (CIP program 120 °C (250 °F) for max. 2 hours)		
Ambient temperature		Aluminum housin	g -30+70 °C (-20+160 °F) with display -25+ Plastic housing: -25+70 °C (-10160 °F)	·70 °C (−10160 °F),		
Pressure (1) (A	bsolute)	0.53	B bar (0.050.3 MPa)	0.91.1 bar (0.090.11 MPa)		
Seals		EPDM	FPM			
Ingress	Sensor	IP68				
protection	Housing	IP67 (NEMA 6)				
Power supply	/ consumption	12 <sup>(3)</sup> 36 V, / 48 mW720 mW, galvanic isolation; protection against surge transients				
Accuracy (2)		$\pm \ (0.2\%$ of the measured distance plus 0.05% of the range)				
Resolution		Depending on the measured distance: < 2 m: 1 mm; 2– 5m: 2 mm; 5–10 m: 5 mm; > 10 m: 10 mm (< 6.5 feet: 40 mil; 6.5 feet to 16 feet: 80 mil; 16 feet to 32 feet: 200 mil; > 32 feet: 400 mil )				
	Analog	$420$ mA ( $3.920.5$ mA), $R_{\text{max}}$ = ( $U_t$ – $12$ V) / $0.02$ isolated protection against surge transients				
	Loop power test connectors	2 pins for mV meter range 200 mV, 0.5%				
Outputs	SPDT relay	30 V / 1 A DC; 48 V / 0,5 A AC				
	Display	6 digits, icons and bar graph, (on SAP-200 display module only)				
	Serial communication	HART interface (terminal resistor 250 Ohm)				
Electrical connection		2x M20x1.5 Metal, Cable Ø713 mm (Ø0.30.5 inch) or M20x1.5 Plastic, Cable Ø612 mm (Ø0.240.47 inch) and 2x ½" NPT for cable gland; Wire cross section: 0.51.5 mm² [2015 AWG]				
Electrical protection		Class III				

<sup>&</sup>lt;sup>(1)</sup> For pressures below 1 bar (14.5 psi) representative of NIVELCO should be consulted.

<sup>(2)</sup> Under optimal circumstances of reflection and stabilized transducer temperature.

Only partial operation is provided. Reliable operation without any restrictions is guaranteed at >13.4 V terminal voltage.

# 3.2 ADDITIONAL DATA FOR EXPLOSION-PROOF CERTIFIED VERSIONS

#### 3.2.1 ATEX APPROVAL No.: BKI16ATEX0017X/2

Туре	S□□-3□□-5Ex S□□-3□□-6Ex S□□-3□□-7Ex S□□-3□□-8Ex	
Ex marking (ATEX)	II 1 G Ex ia IIB T6T4 Ga	
Intrinsically safe data	Ci ≤ 15 nF, Li ≤ 200 $\mu$ H, Ui ≤ 30 V, Ii ≤ 140 mA, Pi ≤ 1 W	
Ex power supply, loading Uo ≤ 30 V, lo ≤ 140 mA, Po ≤ 1 W		
Medium temperature	With PP transducer: -20+70 °C (-4+158 °F) with PVDF transducer: -20+80 °C (-4+176 °F). Temperature class T6.  With PTFE transducer: -30+90 °C (-22+194 °F). Temperature class T5.  With stainless steel transducer: -30+100 °C (-22+212 °F). Temperature class T4.	
Ambient temperature	With metal housing: −30+70 °C (−22+158 °F); with display: −25+70 °C (−13+158 °F); with plastic housing: −20+70 °C (−4+158 °F)	

#### 3.2.2 INMETRO APPROVAL No.: DNV 14.0167 X - REVISION 02

Туре	S□□-3□□-5Ex S□□-3□□-6Ex S□□-3□□-7Ex S□□-3□□-8Ex
Ex marking (INMETRO)	Ex ia IIB T6T4 Ga
Intrinsically safe data	Ci ≤ 15 nF, Li ≤ 200 $_{\nu}$ H, Ui ≤ 30 V, li ≤ 140 mA, Pi ≤ 1 W
Ex power supply, loading	Uo < 30 V, lo < 140 mA, Po < 1 W
Medium temperature	With PP transducer: -20+70 °C (-4°F+158 °F) with PVDF transducer: -20+80 °C (-4+176 °F). Temperature class T6.  With PTFE transducer: -30+90 °C (-22+194 °F). Temperature class T5.  With stainless steel transducer: -30+100 °C (-22+212 °F). Temperature class T4.
Ambient temperature With metal housing: -30+70 °C (-22+158 °F); with display: -25+70 °C (-13+158 °F); with plastic housing: -20+70 °C (-4+158 °F)	

# 3.3 SPECIAL DATA OF THE TRANSDUCERS

SPECIAL DATA OF THE PP AND PVDF TRANSDUCERS (ALSO APPLY FOR EX MODELS)

Туре	SE□-39□-□ SG□-39□-□	SE□-38□-□ SG□-38□-□	SE□-37□-□ SG□-37□-□	SE□-36□-□ SG□-36□-□	SE□-34□-□ SG□-34□-□	SE□-32□-□ SG□-32□-□
Transducer material	PP or PVDF				PP or PVDF PP + foam	PP or PVDF
Maximum measuring distance * [m / (feet)]	4 (13)	6 (20)	8 (26)	10 (33)	15 (49); 20 (66)	25 (82)
Min. measuring distance* (Dead band) [m / (in)]	0.2 (8)	0.25 (10)	0.35 (14)		0.45 (18)	0.6 (24)
Total beam angle (−3 dB)	6°	5°	7° 5°		•	7°
Measurement frequency	80 kHz		50 kHz	60 kHz	40 kHz	20 kHz
Process connection	1½" outer thread	ad 2" outer thread		Flange		

<sup>\*</sup> from the transducer face

SPECIAL DATA OF THE PTFE AND STAINLESS STEEL TRANSDUCERS (ALSO APPLY FOR EX MODELS)


Туре	SE□-39□-□ SG□-39□-□	SE□-38□-□ SG□-38□-□	SE□-37□-□ SG□-37□-□	SE□-36□-□ SG□-36□-□	SE□-34□-□ SG□-34□-□	SE□-32□-□ SG□-32□-□
Transducer material		PTFE			Stainless steel	
Maximum measuring distance * [m / feet]	3 (10)	5 (17)	6 (20)	7 (23)	12 (39)	15 (49)
Min. measuring distance* (Dead band) [m / feet]	0.25	(10)	0.35 (14)	0.4 (16)	0.55 (22)	0.65 (26)
Total beam angle (−3 dB)	6°	5°	7°	5°	5°	7°
Measurement frequency	80	kHz	50 kHz	60 kHz	40 kHz	20 kHz
Process connection	1½" outer thread	2" outer thread			Flange	


<sup>\*</sup> from the transducer face

#### **SAP-200 DISPLAY MODULE**


Field indication	6 digits Custom LCD, icons and bar graph	
Ambient temperature	-25+70 °C (-10+160 °F)	
Housing material	PBT fiber-glass reinforced plastic	


# 3.4 DIMENSIONS

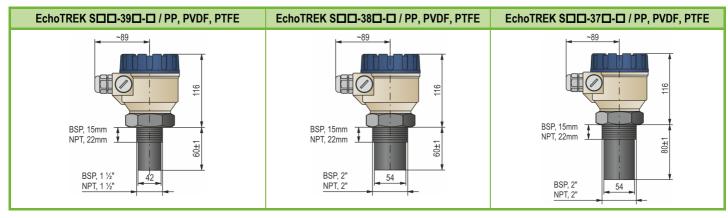


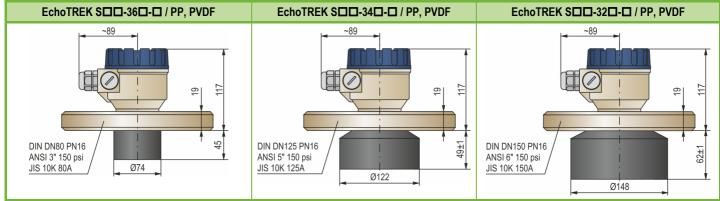

Min required flange size; larger flanges are also available.

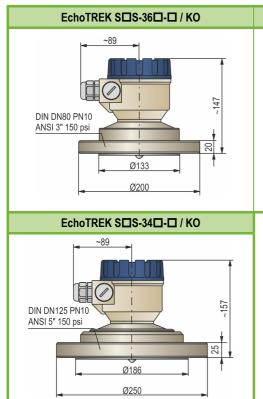

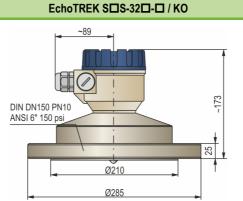

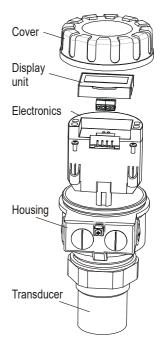

# 3.5 ACCESSORIES

- Warranty Card
- Installation and Programming Manual
- EU Declaration of Conformity

- 2x M20x1.5 cable gland
- SAP-200 Display Module (option)
- CD-ROM (EView2, DataScope softwares) (option)

#### 3.6 Special conditions of safe use

- Intrinsically safe units with Ex ia IIB marking can only be used in certified intrinsically safe loops with the previously given technical data.
   (see values in Additional data for Ex approved models under Point 3)
- The PTFE transducers are made of plastic that can be loaded electrostatically therefore:
  - Filling and emptying speed should be selected according to the medium
  - Fog development of the dangerous material during filling should be avoided.
  - Cleaning of the plastic enclosure is not allowed in hazardous space.
- Equipment with plastic housing are susceptible to electrostatic charges, thus the devices must be protected against electrostatic charges.
- The aluminum content of equipment with metallic enclosure exceeds the limit, the devices must be protected against impact and friction effects.
- The device can be mounted into tanks with up to 3 bar (43.5 psi) process pressure. The apparatus is not suitable as a fire-resistant barrier between the inside and the outside area. After mounting the unit, pressure test of the system should be carried out on a regular basis in accordance to the local regulations at 1.5 times higher pressure than the nominal pressure value.
- Devices should be grounded by connecting their grounding screws to the equipotential system.
- The device should read or programmed through IR port only outside of the explosive hazardous atmosphere because the infrared interface connected to the computer is not an explosion-proof apparatus.

#### 3.7 Maintenance repair, and storage conditions

The device does not require regular maintenance. The warranty card contains the terms and conditions. Before returning the device for repairs, it must be cleaned thoroughly. The parts in contact with the medium may contain harmful substances; therefore, they must be decontaminated. Our official form (Returned Equipment Handling Form) must be filled and enclosed in the parcel. Download it from our website <a href="https://www.nivelco.com">www.nivelco.com</a>. The device must be sent back with a declaration of decontamination. A statement must be provided in the declaration that the decontamination process was successfully completed and that the device is clean from any hazardous substances.

Unused devices must be stored within the ambient temperature range specified in the technical data, with a maximum of 98% relative humidity.

#### 3.7.1 SOFTWARE UPGRADE


Based on the observations & needs of our customers NIVELCO constantly improves and revises the operating software of the device. The software can be upgraded with the help of the IrDA communication port of the SAP-200 or an eLink (USB) communication adapter plugged into the SAP-200 slot. For more information about software updates please contact NIVELCO.


# 4. INSTALLATION


## 4.1 LIQUID LEVEL MEASUREMENT

#### **POSITION**

The optimal position of the **EchoTREK** is on the radius r = (0.3 - 0.5) R of the (cylindrical) tank / silo. (Take also sonic cone on page 1 into consideration.)

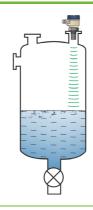


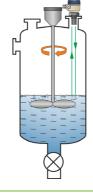

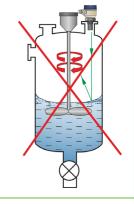


#### SENSOR ALIGNMENT

The sensor face has to be parallel to the surface of the liquid within  $\pm 2 - 3^{\circ}$ .

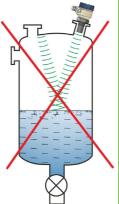

#### TEMPERATURE

Make sure that the transmitter will be protected against overheating by direct sunshine.

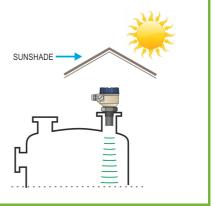


#### **OBSTACLES**

Make sure that no in-flow path or objects (e.g., cooling pipes, ladders, bracing members, thermometers, etc.) or no tank wall of the ragged surface protrude into the sensing cone of the ultrasonic beam. One fix object in the tank / silo that disturb the measurement can be blocked out by the appropriate programming of the **EchoTREK**.



#### STAND-OFF PIPE


The structure of the standoff pipe should be rigid; the inner rim where the ultrasonic beam leaves the pipe should be rounded.

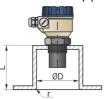

	D <sub>min</sub>					
_	S 🗆 🗆 - 39 🗖	S 🗆 🗆 - 38 🗖	S 🗆 🗆 - 37 🗖			
150	50	60	60			
200	50	60	75			
250	65	65	90			
300	80	75	105			
350	95	85	120			

#### **FOAM**

Foaming of the liquid surface may render ultrasonic level metering impossible. If possible, a location should be found, where foaming is the least (device should be located as far as possible from liquid inflow) or a stilling pipe or well should be used.

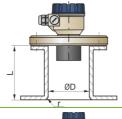


ı	D <sub>min</sub>			
-	S□□-36□	S□□-34□	S□□-32□	
90	80	*	*	
200	80	*	*	
350	85	*	*	
500	90	*	*	

<sup>\*</sup> For values contact your distributor

#### WIND

Intensive air (gas) movements in the vicinity of the ultrasonic cone is to be avoided. A strong draft of wind may "blow away" the ultrasound.

Devices with lower measuring frequency (40, 20 kHz) are \_ recommended.

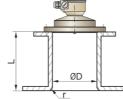

-	D <sub>min</sub>			
-	S□S-36□	S□S-34□	S□S-32□	
320	80	-	*	
440	-	125	*	

<sup>\*</sup> For values contact your distributor

#### **FUMES / VAPORS**

For closed tanks containing chemicals or other liquids, which create fume / gases above the liquid surface especially for outdoor tanks exposed to the sun, a strong reduction of the nominal measuring range of the ultrasonic device is to be considered during device selection.

Devices with lower measuring frequency (40, 20 kHz) are recommended in these cases units.


#### **4.2 OPEN CHANNEL FLOW MEASUREMENT**

- For ultimate accuracy, install the sensor as close as possible above the expected maximum water level (see minimum measuring range).
- Install the device in a place defined by the characteristics of the metering channel along the longitudinal axis of the flume or weir. In case of Parshall flumes supplied by NIVELCO the location of the sensor is marked.
- In some cases, foam may develop on the surface. Make sure that the surface, opposite to the sensor remain free of foam for proper sound reflection.
- From the point of view of measurement accuracy, the length of the channel sections preceding and following the measuring flume and their method of joining to the measuring channel section are of critical importance.
- Despite of the most careful installation, the accuracy of flow metering will be lower than that of specified for the distance measurement. It will be determined by the features of the flume or weir applied.

# 4.3 INSTALLATION AND ELECTRICAL CONNECTION

#### Installation of the (BSP or NPT) threaded models

- Screw the unit in to its place. Use open wrench for tightening; max torque is 20 Nm
- After tightening the enclosure can be rotated to the proper position. (Safety bolt prevents rotation more than 350°)
- The unit may be damaged by electrostatic discharge (EDS) via its terminal, thus apply the precautions commonly used to avoid electrostatic discharge e.g., by touching a properly grounded point before removing the cover of the enclosure.
- Ensure that the power supply is turned off at the source.
- With removal of the cover of the housing and taking out the display module (if any), the screw terminals can be accessed. Suggested cable core cross section: 0.5 – 1.5 mm<sup>2</sup> [20 – 15 AWG]. Arrange grounding by the inner or outer grounding screw first.
- Switch on the unit and make necessary programming.
- After programming ensure proper sealing and closing of the cover.

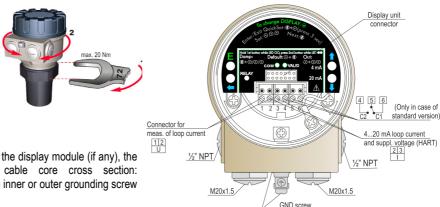

#### 4.4 LOOP CURRENT CHECKING

After removing the cover (and the Display Module if there is any) the actual loop current can be measured with an accuracy of 0.5% by connecting a voltmeter (in the range of 200 mV) to the points indicated on the drawing above

# 5. PROGRAMMING

The **EchoTREK** can be programmed by the following two ways:

- Programming without Display Module see 5.1.
   Assignment of the levels to the 4 and 20 mA current output, error indication by the analogue signal and damping can be set.
- With the SAP-200 Display Module, see 5.2.

  All features of the unit can be set, such as measurement configuration and optimization, 32-point linearization, dimensions for 11 tanks with different shape and for 21 different open channels (flume, weir, etc.).

Devices with the type number **EchoTREK SG**□ are already equipped with the SAP-200.

The EchoTREK is fully operational without the SAP-200. The SAP-200 is only needed for programming and/or displaying measurement values.

The unit will measure during programming in accordance with the previous parameters. The new, modified parameters will only be effective after returning to the Measurement Mode

If the transmitter is left in Programming Mode by mistake, it will automatically return to Measurement Mode after 30 minutes and will operate with the parameters entered during the last completed programming.

The EchoTREK will be delivered with the following Factory Default:

- ⇒ Current output, display and bar graph: LEVEL
- ⇒ Current output and bar graph proportional to the level
- ⇒ 4 mA: assigned to the minimum level 0%
- ⇒ 20 mA: assigned to the maximum level 100%
- ⇒ Error indication by the current output: hold last value
- ⇒ Damping: 60 sec

#### 5.1 Programming without Display Module


Programming is only possible if the EchoTREK is in Level Measuring Mode and receives valid echo i.e., "VALID" LED is lit!

#### The following can be programmed without display module

- Assignment of the 4 mA to a required e.g., min. level / max. distance
- Assignment of the 20 mA to a required e.g., max. level / min. distance
- Error indication by the current output (Hold, 3.6 mA or 22 mA)
- Damping (10, 30 or 60 sec)
- · Reset to the factory default

Note: Current output can also be assigned in inverted mode:


4 mA = 100% (Full), 20 mA = 0% (Empty)

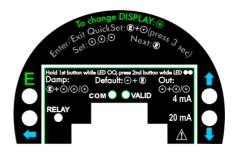

Procedure of programming: press button in the relevant sequence and check the state of the LED-s. Symbols for the states of the LED-s: ○ = LED is off, □ = LED is blinking, □ = LED is on, □ □ = LEDs are blinking alternatively ⊗ = Don't care

#### Minimum level, (0%, empty tank) assignment to 4 mA

Action	Led state following the action
1) Check for a valid ECHO	⊗● = Valid ECHO, transmitter programmable
2) Press NEXT  ← button steadily	○○ = EchoTREK in programming mode
3) Press UP ♠ button steadily	●● = 4 mA assigned to the distance (see picture)
4) Release buttons	○○ = Programming completed

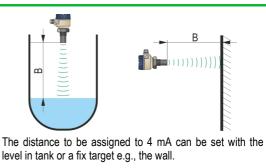

level in tank or a fix target e.g., the wall.

OUT: Maximum level (100%, full tank) assignment to 20 mA

Action	Led state following the action	
1) Check for a valid ECHO	⊗● = Valid ECHO, transmitter programmable	B B
2) Press NEXT ← button steadily	= EchoTREK in programming mode	
3) Press DOWN ◆ button steadily	= 20 mA assigned to the distance (see picture)	
4) Release buttons	CC = Programming completed	The distance to be assigned to 20 mA can be set with the level in tank or a fix target e.g., the wall.

# "Error state" indication by the analogue signal (Check for a valid echo as above)

As a result of this setting the value of the analogue output will be 3.8 mA; 22 mA or according last value (hold) until the error is ceased.

Action		Led state following the action		
1) Press 🏵 button steadily	00	=	EchoTREK in programming mode	
2) Press any of the DOWN ๋, ENTER ๋ Ē, NEXT ๋ € buttons steadily	••	=	<ul><li>hold last value</li><li>3.8 mA</li><li>22 mA</li></ul>	
3) Release buttons	00	=	Programming completed	

Damping time setting (Check for a valid echo as above)

Action	Led state following the action
1) Press ENTER © button steadily	○○ = EchoTREK in programming mode
2) Press any of the NEXT ♠, UP ♠, DOWN ❖ buttons steadily	- 10 sec - 30 sec - 60 sec
3) Release buttons	OO = Programming completed

# DEFAULT: Returning to the default (Check for a valid echo as above)

Action	Led state following the action		
1) Press NEXT   button steadily	○○ = EchoTREK in programming mode		
2) Press ENTER © button steadily	●● = DEFAULT loaded		


# Indication of mistakes (by LEDs) made during programming

Action	Led state following the action	Possible correction
Attempted programming		Find a valid Echo
Attempted programming		With SAP-200 only See 5.2 (P99)
Attempted programming		With SAP-200 only See 5.2 (P01)

#### 5.2 Programming with the SAP-200 display module

The EchoTREK should be adjusted to the process by programming the parameters. The SAP-200 Display Module can be used to display the parameters during programming and measurement values during measurement.

The SAP-200 supports two separately accessible programming modes representing 2-layers of programming complexity, depending on user choice.

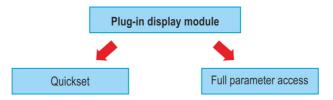

#### **QUICKSET (5.2.4)**

Recommended as a simple and fast way to set up the EchoTREK by 6 basic parameters for the following basic settings, marked by abbreviations easy to remember

- Engineering unit for the display (Metric or US)
- Maximum measuring distance (H)
- Assignment of min level to 4 mA
- Assignment of max level to 20 mA
- Error indication by the current output
- Damping time

#### Full Parameter Access (5.2.5)


All features of the EchoTREK such as:

- Measurement configuration
- Outputs
- Measurement optimization
- 11 pre-programmed tank shapes for volume calculation
- 21 pre-programmed formula for flow metering
- 32-point linearization

# 5.2.1 SAP-200 display module

#### Symbols used on the LCD:

- DIST Distance (measuring) mode
- LEV Level (measuring) mode
- VOL Volume (measuring) mode
- FLOW Open channel (flow metering) mode
- PROG Programming mode (device under programming)
- RELAY 'C2' circuit of the relay is closed
- T1 TOT1 volume flow totalizer (resettable aggregate)
- **T2** TOT2 volume flow totalizer (aggregate)
- FAIL Measurement / device error
- ♠ ♣ Level changing direction
- Bar graph assigned to the current output or echo strength

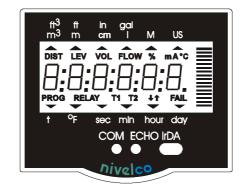

#### Symbols used on the frame:

- M Metric system
- US US calculation system

#### **LEDs lit**

- **COM** digital (Hart) communication
- VALID presence of valid echo

**IrDA** – Infrared communication port for logger readout, diagnostics and software upgrade.

# 5.2.2 Steps of the SAP-200 display module

Programming will be performed by the pressing and releasing the relevant one or two keys (simultaneously).


#### Single key pressing

ENTER © to select parameter address and go to parameter value to save parameter value and return to parameter address

NEXT • to move the blinking (sign of change) of the digit to the left

UP • to increase value of the blinking digit

DOWN • to decrease value of the blinking digit

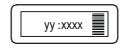


yy parameter address (P01, P02...P99)
xxxx parameter value (dcba)
bargraph


#### Double key pressing

Press the two keys simultaneously for desired programming step. Thereafter, the combined pressure is marked with "+".


#### Enter into or quit programming modes

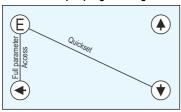

#### Basic steps while parameter address is blinking

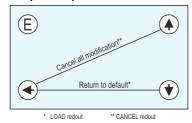

#### Basic steps while parameter value is blinking

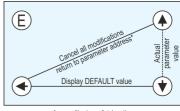

\* cancellion immediately active

#### **GET LEVEL** function

Special function used only in level and distance measurement modes UP ♠ + DOWN ♠ Notes:

If after pressing ENTER (E) blinking does not spring over from the parameter address to the parameter value this means that


- the parameter is either a read-out type, or
- the secret code prevents the modification (see P99)

If the modification of the parameter value is not accepted i.e., the parameter value keeps blinking after pressing ENTER (E),

- the modified value is either out of the range, or
- the code entered is not a valid code

#### 5.2.3 Indications of the SAP-200 and led status



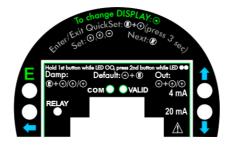

#### LED indication:

- VALID (ECHO)-LED
  - lit in case of valid echo.
- COM-LED
  - flashes during HART message exchange
  - lit when the device is in remote programming mode
- RELAY-LED
  - ON when the 'C2' circuit of the relay is closed

#### **SAP-200 indications**

Depending on the measurement one of the below symbols will lit and the process value displayed (see P01 chapter 6.1). Engineering units will be indicated directly (°C, °F and mA) and by the lit arrow showing towards them on the frame

- DIST distance
- LEVlevel
- VOL volume
- FLOW flow
- T1/T2 totalized values
- FAIL (blinking) Error code displayed

For paging readouts NEXT key should be pressed.

#### The following process values can be displayed


- Volume / Flow if programmed so
- Level if programmed so
- Distance if programmed so
- Warning indications FAIL blinking

Display screens can be scrolled by pressing key NEXT ①. To return to the screen of the selected measurement mode key ENTER ⑤ should be pressed (see P01 chapter 6.1)

Temperature can be displayed by pressing UP ①.



For paging readouts NEXT  $\odot$  key should be Current output value can be displayed by pressing DOWN  $\odot$ .

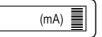

# See P01 for possible readouts (Distance)

#### 5.2.4 QUICKSET

#### Recommended as a simple and fast way to start up EchoTREK.

QUICKSET programming (aided by 6 screens) is used in uncomplicated level metering applications to set the 6 basic parameters. The other parameters can only be modified in the Full Parameter Access Mode see 5.1 (P01).

The instructions of this programming mode are also to be found on the front panel above the Display Module socket.



Keys	Function	
(E) + → (press for min 3 secs!) Enter or exit QUICKSET programming mode		
♠, ♠, ♠ Increase/decrease and move left the blinking digit		
♠ + ♦  "GET LEVEL" – display actual level measured by the EchoTREK		
© Save readout and step to the next screen		
◆ + ◆		
◆ + ◆ Display of the DEFAULT value.		

Screens	Actions			
AP :xxyy	Application xx= select "EU" (European) for metric or "US" for US engineering units (Use UP ♠ / DOWN ♠ keys) yy= indicating "Li" for liquids  DEFAULT: EU  ATTENTION!  Programming of this parameter will result in loading the factory default with the corresponding engineering units.			
H:xxxx	H = xxxxx maximum measuring distance – Distance between transducer face and tank bottom  Manual: set value (Use UP ♠ / DOWN ♠ / NEXT ♠ keys) and save it (by ENTER ⑤)  Automatic: use the "GET LEVEL" function (UP ♠ + DOWN ♠) to obtain actual measured value with level in tank or a fixe target, i.e., wall. ("GET LEVEL" functions only if ECHO LED is lit) and save it as above.  DEFAULT: maximum measuring distance [m], see Technical Data Table			
4 mA xxxx – level value assigned to 4 mA current output  Manual: set level value (by UP ) / DOWN ) / NEXT (keys) and save it (by ENTER )  Automatic: use the "GET LEVEL" function (UP + DOWN ) to display the actual measured value with level in tar fixed target, i.e., wall. ("GET LEVEL" functions only if ECHO LED is lit) and save it as above.  DEFAULT: 0 m (0%, Empty tank).				

Screens	Actions
	20 mA xxxx – level value assigned to 20 mA current output
	Manual: set level value (Use UP ♠ / DOWN ❖ / NEXT ❖ keys) and save it (by ENTER ⑤)
20:xxxx	Automatic: use the "GET LEVEL" function (UP ♠ + DOWN ♠) to obtain actual measured value with level in tank or a fixed target, i.e., wall. ("GET LEVEL" functions only if ECHO LED is lit) and save it as above.  DEFAULT: max. level = max. measuring distance – dead band [m] (100%, Full tank) (See Technical Data Table)
Er:xxxx	Error indication by the current output – select "Hold", 3.8 mA or 22 mA (by UP ♠ / DOWN ♥ key) and save it as above. DEFAULT: hold last value
dt: xxxx	<b>Damping time:</b> select required damping time (by UP ♠ / DOWN ♠ key) and save it as above. DEFAULT: 60 sec for liquids, 300 sec for solids

Note: - Current output can also be programmed for inverted operation: 4 mA= 100% (Full), 20 mA= 0% (Empty)

- Description of failures can be found under the chapter 7 Error codes.


# 5.2.5 Full parameter access

Full Parameter Access is the highest programming level to access all features provided by the EchoTREK

Description of all parameters can be found under the chapter "Parameter" (Chapter 6.).

Keys	Function		
(E) + ◆ (press for 3 seconds)	Enter or exit Full Parameter Access programming mode.		

In this programming mode, the display will indicate:

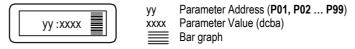

Measuring is going on during programming in accordance with the old parameter set. New parameter set will be valid after returning to the Measurement to the Programming Mode.

Steps and indications of the Full Parameter Access programming mode

Keys	Parameter Address is blinking	Parameter Value is blinking		
(E)	Go to the Parameter Value	Save the modification of the Parameter Value and return to the Parameter Address		
<b>€</b> + <b>♦</b>	Cancel all modifications of the actual programming phase. Pressing for 3 sec is required while CANCEL will be displayed for warning	Neglect the modification of the Parameter Value. and return to the Parameter Address without saving the modifications		
<b>◆</b> + <b>•</b>	Reset entire device to Factory Default.  Since this action will reset all parameters, "LOAD" will appear on the display:  - to confirm, press ©  - to escape, press any other key  - Exception: clearing TOT 1 (See at P77)	Display default of the Parameter Values (it can be saved by pressing ENTER (E))		
•	Move blinking (changeability) of the digit to the left			
<b>⊕</b> / <b>⊕</b>	Modify the blinking digit (increase, decrease) or scroll up / down			

# 6. PARAMETERS - DESCRIPTIONS AND PROGRAMMING

#### **6.1 MEASUREMENT CONFIGURATION**

P00: - c b a Application/Engineering Units

Programming of this parameter will result in loading the factory default with the corresponding engineering units.

а	Operating (measurement) mode
0	Liquid level measurement

b	Engineering units (according to "c")		
	Metric	US	
0	m ft		
1	cm Inch		

С	Calculation system		
0	Metric		
1	US		

**FACTORY DEFAULT: 000** 

Attention: mind the sequence! When programming this parameter, the right value "a" will be blinking first.

#### P01: -- b a Measurement Mode - Bar graph

Parameter value "a" will determine the basic measurement value that will be displayed and proportional with the current output. Depending on the value of "a" process values as listed in the 3d column can also be displayed by pressing NEXT ④. For return to the display of the basic value the ENTER © key should be pressed.

а	Measurement Mode	Display symbol	Displayed values
0	Distance	DIST	Distance
1	Level	LEV	Level, Distance
2	Level in percentage	LEV%	Level%, Level, Distance
3	Volume	VOL	Volume, Level, Distance
4	Volume in percentage	VOL%	Volume%, Volume, Level, Distance
5	Flow	FLOW	Flow, TOT1, TOT2, Level, Distance

Attention: mind the sequence!
When programming this parameter,
the right value "a" will be blinking
first.

Parameter value "b" will determine that the height of the Bar graph will be proportional to the current output or to the Echo strength.

b	Bar graph indication		
0	Echo strength		
1	Current output		

**FACTORY DEFAULT: 11** 

#### P02: - c b a Calculation unit

a	Temperature
0	°C
1	°F

Attention: mind the sequence!
When programming this parameter, the right value "a" will be blinking first.

This table is interpreted according to P00(c), P01(a) and P02(c) and is irrelevant in case of percentage measurement (P01(a)= 2 or 4)

L V		ume	Weight (se	t also P32)	Volume flow	
В	Metric	US	Metric	US	Metric	US
0	m³	ft <sup>3</sup>	ton	lb (pound)	m³/time	ft <sup>3</sup> /time
1	liter	gallon	ton	ton	liter/time	gallon/time

С	Time
0	sec
1	min
2	hour
3	day

FACTORY DEFAULT: 000

#### P03: --- a Values displayed - Rounding

It is important to keep in mind that the instrument is measuring distance as basic quantity.

Measured Distance	Resolution
X <sub>min</sub> – 2 m	1 mm
2 m – 5 m	2 mm
5 m – 10 m	5 mm
over 10 m	10 mm

The resolution depending on the distance can be considered as a kind of rounding that will be contained in all further value (of level, volume or volume flow) calculated. Therefore, if programmed for DIST or LEV measurement the setting of P03 is irrelevant.

#### Displayed VOL or FLOW

·	
Displayed Value	Display Format
0,000 - 9,999	X,XXX
10,000 – 99,999	XX,XX
100,000 - 999,999	XXX,X
1000,000 – 9999,999	XXXX,X
10000,000 - 99999,999	XXXXX,X
100000,000 - 999999,999	XXXXXX,X
1 million – 9,99999*10 <sup>9</sup>	x,xxxx : e (exponential format)
1*10 <sup>10</sup> over	(overflow) Err4

Obviously, the decimal position will be shifted with increasing value displayed. (See table at the left).

Values over one million will be displayed in exponential format whereas the value (e) represents the exponent. Over the value of 1\*10<sup>10</sup> Err4 (overflow) will be displayed.

#### Rounding

<b>J</b>		
Parameter Value "a"	Steps in the displayed value	
0	1 (no rounding)	
1	2	
2	5	
3	10	
4	20	
5	50	

A couple of millimeters of fluctuation of the basic DIST value (e.g., due to waves) will be enlarged by the mathematical operations. This enlarged fluctuation in displaying VOL or FLOW can (if disturbing) be avoided by rounding to be set in P03. Rounding value 2, 5, 10 etc. represents the steps by which the calculated value will be changed in its (one or two) last digit(s).

Examples:

**P03**=1 steps by: 1,000; 1,002; 1,004 **P03**=5 steps by 50: 1,000; 1,050; 1,100 or

10,00; 10,05(0); 10,10(0); 10,15(0)

(the 0 from the steps 50, 100, 150 etc. will not be displayed)

**FACTORY DEFAULT: 0** 

#### P04 Maximum Distance to be Measured (H)

The maximum distance to be measured is the greatest distance between the surface of the transducer and the level to be measured.

This is the only parameter that has to be programmed for each application other than distance (however to avoid disturbing effect of possible multiple echoes it is suggested to do this in distance measurement applications too).

Values of the maximum measuring distance will be displayed as below.

Engineering Unit	Display Format
m	X,XXX OF XX,XX
cm	XXX,X
ft	XX,XX OF XXX,X
inch	XXX,X

#### FACTORY DEFAULT: according to the table

The factory programmed, greatest distances (DEFAULT values) which **can be measured** by the units are listed in the table below. For the actual application the maximum distance **to be measured** i.e., the distance between the sensor and the bottom of the tank should be entered in P04. To obtain the best accuracy, measure this distance in the empty tank with the EchoTREK by using the "GET LEVEL" function (by double key pressing of UP (\*) + DOWN (\*)) provided the bottom is flat. Enter the actual measured value displayed as P04.

EchoTREK	Maximum measuring distance X <sub>M</sub> [m (ft)]		
Transmitters for liquids	Transducer material PP / PVDF	Transducer material PTFE	Transducer material Stainless steel
S-39	4 (13)	3 (10)	_
S-38	6 (20)	5 (17)	-
S-37	8 (26)	6 (20)	-
S-36	10 (33)	-	7 (23)
S-34	15 (49)	_	12 (39)
S-32	25 (82)	_	15 (49)

FACTORY DEFAULT: according to the table

Considering that the level (L), measured by the device, is obtained by measuring the difference between the distance (H) entered in **P04** of the application and the distance (DIST) measured by the device, it is crucial that the entered value is correct. To obtain the above value accurately, it is recommended to measure this distance with the EchoTREK then the tank is empty.

Use INITIALIZATION (by pressing the 🌖 + 🌗 buttons simultaneously twice) to access this function and the 📵 button to save the value.

#### P05: Minimum measuring distance (Dead zone- Close-end blocking)

The EchoTREK will not accept any echo within the blocking distance set here.

#### Automatic Close-end-blocking (Automatic Dead Band control)

By using the factory default value, the unit will automatically set the smallest possible close-end-blocking distance i.e., the dead band.

#### Manual close-end-blocking

Manual close-end-blocking should be used for example to block out the echo originating from the bottom rim of a stand-off pipe or from any object protruding into the ultrasonic cone near to the transmitter.

By entering a value, higher than the factory default, the minimum measuring range will be extended and fixed to the specified value.

To return to the factory programmed (DEFAULT value) of the minimum measuring distance press NEXT 👽 + DOWN 👽 .

EchoTREK	Minimum measuring distance X <sub>m</sub> [m (in)]		
Transmitters for liquids	Sensor material PP / PVDF	Sensor material PTFE	Sensor material Stainless steel
S-39	0.2 (8)	0.25 (40)	-
S-38	0.25 (10)	0.25 (10)	-
S-37	0.25 (14)	0.35 (14)	-
S-36	0.35 (14)	-	0.4 (16)
S-34	0.45 (18)	-	0.55 (22)
S-32	0.6 (24)	-	0.65 (26)

FACTORY DEFAULT: automatic dead band control

#### P06: Far end blocking


Far end blocking is used to neglect incorrect level/volume readings and output actions below a pre-set level programmed in P06.

#### A). Level measurement

The far-end blocking can be used to avoid disturbing effect of stirrer or heaters at the bottom of the tanks.

# If the level of the medium sinks below the blocked-out range:

- "Sub 0" will be indicated for the level and volume
- Distance value is not interpretable
- Current output will hold the value corresponding to the far end blocking level

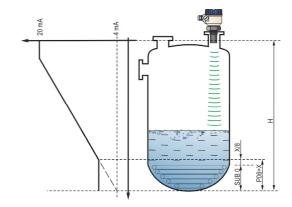

#### If the medium level is above the blocked-out range:

The calculation of level and volume will be based on the programmed tank dimensions, therefore the measured or calculated process values will not be influenced in any way, by the far end blocking value.

#### B). Open channel flow metering

Far end blocking will be used for those small levels below which the accurate volume flow calculation is no longer possible.

#### If the liquid level in the flume/weir falls below the blocked-out range:

The EchoTREK will act as follows:

- Indicate "No Flow" on the Display
- Hold last valid data on the current output.

#### If the level in the flume/weir is above the blocked-out range:

The calculation of volume flow will be based on the programmed flume/weir data; therefore, the measurement values will not be influenced in any way, by the far end blocking value.

**FACTORY DEFAULT: 0** 

#### **6.2 CURRENT OUTPUT**

P10: "4 mA" – Value (of distance, level, volume or flow) assigned to 4 mA current output

#### P11: "20 mA" – Value (of distance, level, volume or flow) assigned to 20 mA current output

Values are interpreted according to **P01(a)**. Please note that in case of programming for (LEV or VOL) % measurement the min and max value has to be entered in the relevant engineering units of LEV (m, ft) or VOL (m³, ft³).

Assignment can be made so that the proportion between the change of the (measured or calculated) process value and the change of the current output be either direct or inverse. E.g., lev 1 m (3.3 feet) assigned to 4 mA and lev 10 m (33 feet) assigned to 20 mA represents direct proportion and lev 1 m (3.3 feet) assigned to 20 mA and lev 10 m (33 feet) assigned to 4 mA represents the inverse proportion.

#### **FACTORY DEFAULT:**

P10 0 level (max. distance)

P11 max level (min. distance) H - X<sub>M</sub>

#### P12: ---a Error indication by the current output

In case of error the EchoTREK will provide one of the current outputs below. (For errors and their interpretation see Chapter 7).

а	Error indication (according to NAMUR)
0	HOLD (Hold last value)
1	3.8 mA
2	22 mA

**FACTORY DEFAULT: 0** 

## **6.3 RELAY OUTPUT**

#### P13: --- a Relay function

а	Relay function		Also set
0	DIFFERENTIAL LEVEL CONTROL (Hysteresis control) Relay is energized if the measured or calculated value exceeds the value set in P14 Relay is de-energized if the measured or calculated value descends under the value set in P15.		P14, P15 There is a need to set (in level min 20 mm) hysteresis between P14 and P15 P14 > P15 – normal operation P14 < P15 – inverted operation
1	"noECHO" Relay is energized in case of Echo Loss		-
2	"noECHO" Relay is de-energized in case of Echo Loss		-
3	COUNTER Used for open channel flow metering. A 140 msec pulse is generated every 1, 10, 100, 1.000 or 10.000 m³ according to P16.		P16= 0: 1m <sup>3</sup> P16= 1: 10 m <sup>3</sup> P16= 2: 100 m <sup>3</sup> P16= 3: 1.000 m <sup>3</sup> P16= 4: 10.000 m <sup>3</sup>

In de-energized state of the device the "C1" circuit is closed.

The "Relay" LED is on when the "C2" circuit is closed.

FACTORY DEFAULT: P13 = 2

P14: ---- Relay parameter - Operating value

P15: ---- Relay parameter - Releasing value

P16: ---- Relay parameter – pulse rate P13(3)

FACTORY DEFAULT: P14 = 0, P15 = 0, P16 = 0

#### **6.4 DIGITAL OUTPUT**

#### P19: ---- HART polling address (only HART capable types)

The polling address can be set between 0 and 15. For a single instrument the polling address is 0 and the output is 4...20 mA (analogue output). If multiple units are used in HART Multidrop mode (max. 15 pcs) the polling addresses should differ from 0 (1...15), in this case the output current will be fixed at 4 mA

# 6.5 MEASUREMENT OPTIMIZATION

## P20: ---a Damping

This parameter can be used to reduce unwanted fluctuation of the display and output.

	Domning time	LIQUIDS	
а	Damping time (seconds)	None/moderate fume or waves	Heavy/dense fume or turbulent waves
0	no filter		
1	3	applicable	not recommended
2	6	recommended	applicable
3	10	recommended	recommended
4	30	recommended	recommended
5	60	recommended	recommended

FACTORY DEFAULT: 60 sec

#### P22: --- a Dome top tank compensation

This parameter can be used to reduce disturbing effect of possible multiple echoes.

а	Compensation	Applied
0	OFF	In case the EchoTREK is not mounted in the center of the top and the top is flat.
1	ON	In case the EchoTREK is mounted in the center of a tank with dome-shaped top

FACTORY DEFAULT: 0

#### P24: --- a Target tracking speed


In this parameter evaluation can be speed up at the expense of the accuracy.

а	Tracking speed	Remark
0	Standard	For most applications
1	Fast	For fast changing level
2	Special	Only for special applications (measuring range is reduced to 50% of the nominal value)  The measuring window is inactive and the EchoTREK will respond practically instantly to any target.  Recommended to fast target tracking, but usually not applicable for level metering.

FACTORY DEFAULT: 0

#### P25: - - - a Selection of Echo within the measuring window

A so-called measuring window is formed around the echo signal. The position of this measuring window determines the flight time for calculation of the distance to the target. (the picture below can be seen on the test oscilloscope).

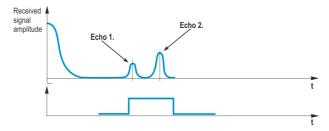

Some applications involve multiple (target + disturbing) echoes even within the measuring window. Basic echo selection will be done by the Quest + software automatically. This parameter only influences the echo selection within the measuring window.

а	Echo in the window to be selected Remark		
0	With the highest amplitude	For most applications (both with liquids and solids)	
1	1 First one For liquids applications with multiple echoes within the Measuring Window		

**FACTORY DEFAULT: 0** 

#### P26: Level elevation rate (filling speed) (m/h)

#### P27: Level descent rate (emptying speed) (m/h)

These parameters provide additional protection against echo loss in applications involving very heavy fuming.

The parameters must not be smaller than the fastest possible filling/emptying rate of the actual technology.

For all other applications, use the factory default setting.

FACTORY DEFAULT:

**P26**: 2000 **P27**: 2000

# P28: - c b a Echo loss indication

а	Echo loss indication	Remark				
0	Delayed indication	During echo-loss, display and analogue output will hold last value. If the echo-loss prevails for 10 sec plus the time period set in <b>P20</b> (damping time), the reading on the display will change to "no Echo" and the outputs will change according to the "Error Indication Mode" preset in <b>P12</b>				
		Holding value Value blinking for (b+1)*P20 for (c+1)*P20  Readout time time No Echo  t				
		ECHO loss LED Current 22 mA P12 = 2				
		Current output Holding value Holding value P12 = 0				
		Current 3.8 mA P12 = 1				
1	No indication	For the time of echo-loss, display and analogue output will hold last value.				
2	Advance to full	During echo-loss in case of filling, the reading on the display and analogue output will shift towards the "full" tank state with a level elevation rate (filling speed) pre-set in <b>P26</b>				
3	Immediate indication	In case of echo-loss, the display will immediately change to "no Echo", and the outputs will change according to the "Error Indication Mode" pre-set in P12				
4	Empty tank indication	Echo-loss may occur in completely empty tanks with a spherical bottom due to deflection of the ultrasonic beam, or in case of silos with an open outlet.				
	Empty talk indication	If the echo is lost when the tank is completely empty, the indication will correspond to empty tank, in all other cases echo-loss indication will function according to the "Delayed".				

#### P29: Blocking out of disturbing object

One fixed object in the tank, disturbing the measurement, can be blocked out.

Enter distance of the object from the transducer. Use the Echo Map (P70) to read out the precise distance of disturbing objects.

**FACTORY DEFAULT: 0** 

## P31: Sound velocity at 20 °C (m/sec or ft/sec depending on P00(c))

Use this parameter if the sound velocity in the gases above the measured surface differs largely from that of in air.

Recommended for applications where the gas is more or less homogeneous. If it is not, the accuracy of the measurement can be improved using 32-point linearization (P48, P49).

For sound velocities in various gases see section "Sound Velocities".

FACTORY DEFAULT: Metric (P00: "EU"): 343.8 m/s, US (P00: "US"): 1128 ft/s

#### P32: Specific gravity (kg/dm³ or lb/ft³ depending on P00 (c))

If you enter a value (other than "0") of specific gravity in this parameter, the weight will be displayed instead of VOL in ton or lb/ton depending on **P00** (c), and **P02** (b).

#### **6.6 DATA LOGGER**

The logger of the device can store 12 288 events. The registry is in a non-volatile (FLASH) memory, so the registry will retain its contents even in case of a power failure. The on-board clock of the device is protected against short power-outs, and keeps working for at least 15 days after the device is switched off. The battery protecting the clock needs at least two hours to be recharged.

The logger operates in two basic ways.

Linear logging, whereby an entry is logged after every time period configured in P35.

**Event-controlled logging**, whereby an entry is logged after an internal event occurs or condition is fulfilled.

The capacity of the registry allows the following logging times in linear logging mode:

P35 [min]	Time of logging	Note
0	3 – 5 hours	Depends on device type and measurement cycle time.
1	7 – 8 days	
5	40 days	
10	80 days	
60	500 days (16 months)	

#### Content of a log:

- entry time (with an accuracy of 1 minute)
- primary measured value (P01)
- level and distance values
- sensor temperature
- output current
- error and status variables

The registry can be erased in parameter P79. See: P79.

## P34: - cba Logging mode

a	Operating mode	Parameters to be programmed
0	No logging	
1	Linear logging	P35 – interval (minute)
2	Event-controlled logging when the primary value changes	P35 – absolute value of variation
3	Event-controlled logging when primary value changes	P35 – variation in %
4	Event-controlled logging when the primary value gets out	P35, P36 – absolute values of range
	of range	limits

b	Logging of errors and warnings (a>0)			
0	0 No logging			
1	Logging of all errors and warnings			
2	2 Logging of errors only			
3	Logging of <b>NoEcho</b> only			

С	Logging of changes in status (a>0)			
0	No logging			
1	Logging of change in status			

FACTORY DEFAULT: 000 (no logging)

Errors that may generate an entry if P34/b<>0: NOECHO, ERR 16, ERR12, ERR13, ERR14, ERR15, SUB0, ERR4, ERR5, PT ERR (temperature measurement error).

# P35-36: Log value 1 and log value 2

P34a	Operating mode		Function of P35 and P36
0	No logging		
1	Linear logging		One entry after every measurement cycle.
		P35 <> 0	Logging interval (minutes)
		P36	Value is indifferent.
2	Event-controlled logging when the primary value changes	P35	Absolute value of the change in the primary measured value (according to P01a)
	Ŭ		P35 is defined as the dimension of the primary measured unit.
			Log entry occurs if the value of the primary measured value deviates from
			the measured value of the previous cycle in any direction by the amount
			specified in P35.
		P36	Value is indifferent
3	Event-controlled logging when the primary	P35	Relative (%) value of primary measured value (according to P01a) variation.
	value changes		P35 is a relative quantity so its dimension is percent.
			Log entry occurs if the value of the primary measured value deviates from the
			measured value of the previous cycle in any direction by the amount
			specified in P35.
		P36	Value is indifferent.
4	Event-controlled logging when the primary	P35, P36	Absolute values of the limits of the range of the primary measured values
	value gets out of range in any direction		(according to P01a). P35 and P36 have the same dimension as the primary measured value.
			Log entry occurs if the value of the primary measured value steps
			over the limit given in P35 and P36, in any direction.
			To monitor only one limit value, set it in P35 and let P36 be 0.

FACTORY DEFAULT: P35 = 0, P36 = 0

P37: yyyy Real-time clock, year

Year setting for date of the on-board clock. (2005)

P38: mmdd Real-time clock, month and day

Month (mm) and day (dd) setting for date of the on-board clock.

P39: HHMM Real-time hour and minute

Hour (HH) and minute (MM) setting of the on-board clock.

### 6.6.1 READING DATA OUT FROM THE LOGGER

The content of the log cannot be displayed with an SAP-200. Reading the logger is only possible with digital communication. For this purpose, either the SAP-200's built-in IrDA port or an eLink (USB) communication adapter plugged into the SAP-200 slot can be used. The content of the log can also be read out via HART communication, but because of the slow speed of HART, it takes several hours. To access the data content the use of NIVELCO's DataScope program is recommended. During the high-speed communication with eLink or SAP-200 the device sets the output current to 22 mA.

There is no measurement while retrieving data from the register, so measurement values are not updated.

#### Connecting to a PC using an IrDA adapter:



The IrDA adapter and the IrDA port of the device must be placed within a 5...10 cm distance and facing each other!

Recommended IrDA adapters: (only IrDA to RS232 adapters can be used) \*

RedSnake: IL-200
 ActiSvs: ACT-IR20

ACT-IR200S ACT-IR220I +

ACT-IR220LF

- Esis: M8421

\* Recommended RS232-USB adapters for using the USB port

STLab: USB-RS232

MOXA: NPort-U1110 UPort 1110

After connecting the adapters start DataScope program. The program and the User's Manual can be found on the website of NIVELCO.

## **6.7 VOLUME MEASUREMENT**

P40: -- ba Tank shape

ba	Tank shape	Programmable parameters
b0	Standing cylindrical tank shape (value of "b" as below)	P40 (b), P41
01	Standing cylindrical tank with conical bottom	P41, P43, P44
02	Standing rectangular tank (with chute)	P41, P42, P43, P44, P45
b3	Lying cylindrical tank shape (value of "b" as bellow)	P40 (b), P41, P42
04	Spherical tank	P41

Attention!
The value "a" determining the shape of the tank should be set first.


FACTORY DEFAULT: 0

#### P41-45: Tank dimensions


Standing cylindrical tank with hemispherical bottom a = 0

P04 P41 P40 b=3 b=2 b=0

Standing cylindrical tank with conical bottom a = 1, b = 0

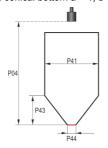


Standing rectangular tank with or without chute a = 2, b = 1

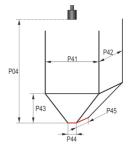


if no chute **P43**, **P44** and **P45** = 0

Lying cylindrical tank, a = 3

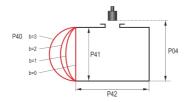

Spherical tank, a = 4, b = 0

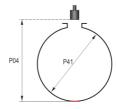


# 6.8 VOLUME FLOW MEASURING

P40: -- b a Devices, formula, data

ba			Devices, fo	rmula, data			Programmable parameters
		Туре	Calculation formula	Qmin [l/s]	Qmax [l/s]	"P" [cm]	
00		GPA-1P1	Q [l/s] = $60.87 \cdot h^{1.552}$	0.26	5.38	30	P46
01	ne I	GPA-1P2	Q [l/s] = 119.7*h <sup>1.553</sup>	0.52	13.3	34	P46
02	=	GPA-1P3	Q [l/s] = 178.4*h <sup>1.555</sup>	0.78	49	39	P46
03	rsha	GPA-1P4	Q [l/s] = 353.9*h <sup>1.558</sup>	1.52	164	53	P46
04	Pal	GPA-1P5	Q [l/s] = 521.4*h <sup>1.558</sup>	2.25	360	75	P46
05	NIVELCO Parshall flume	GPA-1P6	Q [l/s] = 674.6*h <sup>1.556</sup>	2.91	570	120	P46
06	¥	GPA-1P7	Q [l/s] = 1014.9*h <sup>1.556</sup>	4.4	890	130	P46
07	_	GPA-1P8	Q [l/s] = 1368*h <sup>1.5638</sup>	5.8	1208	135	P46
08		GPA-1P9 Q [l/s] = 2080.5*h <sup>1.5689</sup>		8.7	1850	150	P46
09	General PARSHALL flume					P46, P42	
10		PALMER-BOWLUS (D/2) P46, P41					P46, P41
11		PALMER-BOWLUS (D/3) P46, P41					P46, P41
12		PALMER-BOWLUS (Rectangular) P46, P41, P42					P46, P41, P42
13			Khafagi	Venturi			P46, P42
14			Bottom-s	step weir			P46, P42
15	Suppressed rectangular or BAZIN weir					P46, P41, P42	
16	Trapezoidal weir P46, P41, P42					P46, P41, P42	
17						P46, P42	
18	·				P46, P42		
19	THOMSON (90°-notch) weir P46						
20		Circular weir P46, P41				P46, P41	
21			General flow formula: Q[I/	s] = 1000* <b>P41</b> *h <sup>f</sup>	<sup>242</sup> , h [m]		P46, P41, P42

# P41-45: Flume / weir dimensions

P40=00	NIVELCO Parshall flur	mes (GPA-1P1 .	GPA-1P9)	
	For further details see the Manual of the Parshall flume.		Parshall flume.	EasyTREK   EasyTREK
P40=09	General Parshall flume 0.305 < P42 (width) < 2.44 Q [l/s] = 372*P42*(h/0.305) <sup>1.569*P420.026</sup>		26	P P42
	2.5 < <b>P42</b> Q [l/s] = K* <b>P42</b> *h <sup>1,6</sup> P = 2/3*A	P42 [m] 3.05 4.57 6.10 7.62 9.14 15.24	K 2.450 2.400 2.370 2.350 2.340 2.320	EasyTREK P46

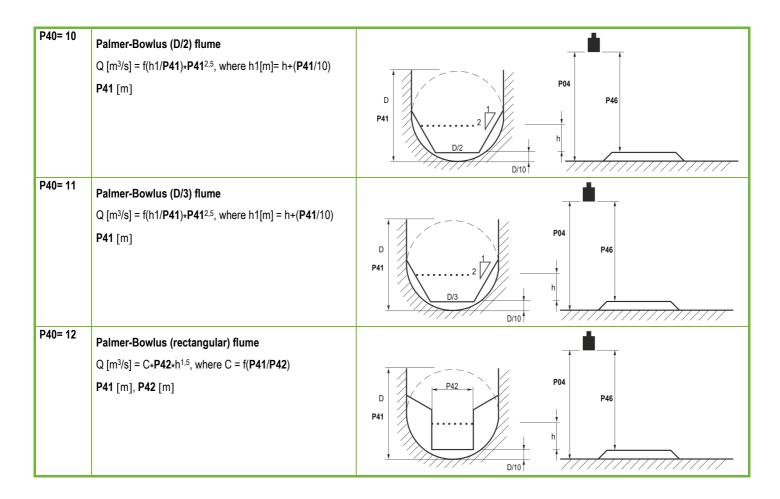

P40= 13	Khafagi Venturi flume Q [m³/s] = 1,744 ·P42 · h¹.5 + 0,091 · h².5 P42 [m] h [m]	EasyTREK P42  EasyTREK P46  P46
P40= 14	Bottom step weir 0,0005 < Q [m³/s] < 1 0,3 < P42 [m] < 15 0,1 < h [m] < 10 Q [m³/s] = 5,073 • P42 • h¹.5 Accuracy: ±10%	P42
P40= 15	Suppressed rectangular or BAZIN weir 0,001 < Q [m³/s] < 5 0,15 < P41 [m] < 0,8 0,15 < P42 [m] < 3 0,015 < h [m] < 0,8 Q [m³/s] =1,77738(1+0,1378h/P41) · P42 · (h+0,0012) <sup>1,5</sup> Accuracy: ±1%	P42

P40= 16	Trapezoidal weir $0,0032 < Q \text{ [m}^3/\text{s]} < 82$ $20 < \textbf{P41}[^\circ] < 100$ $0,5 < \textbf{P42} \text{ [m]} < 15$ $0,1 < h \text{ [m]} < 2$ $Q \text{ [m}^3/\text{s]} = 1,772 \cdot \textbf{P42} \cdot h^{1.5} + 1,320 \cdot \text{tg}(\textbf{P41}/2) \cdot h^{2.47}$ Accuracy: $\pm 5\%$	P42 P41
P40= 17	Special Trapezoidal (4:1) weir 0,0018 < Q [m³/s] < 50 0,3 < P42 [m] < 10 0,1 < h [m] < 2 Q [m³/s] = 1,866 • P42 • h¹.5 Accuracy: ±3%	99 A
P40= 18	V- notch weir 0,0002 < Q [m³/s] < 1 20 < P42[°] < 100 0,05 < h [m] < 1 Q[m³/s] = 1,320 · tg(P42/2) · h².47 Accuracy: ±3%	P42

P40= 19	THOMSON (90°-notch) weir 0,0002 < Q [m³/s] < 1 0,05 < h [m] < 1 Q[m³/s] = 1,320 · h².47 Accuracy: ±3%	h h h h h h	P42
P40= 20	Circular weir $0,0003 < Q [m^3/s] < 25$ $0,02 < h [m] < 2$ $Q[m^3/s] = m*b \cdot D^{2.5}$ , where $b = f (h/D)$ $m = 0,555 + 0,041 \cdot h/P41 + (P41/(0,11 \cdot h))$ Accuracy: $\pm 5\%$	P04   P46   P46	P41

## P46: Distance between transducer face and level of Q=0

P46 is always the distance between the transducer face and the level, where the volume flow is 0 (Q = 0), see figures. (P06=0).

#### 6.9 32- POINT LINEARIZATION

#### P47: --- a Linearization

Linearization is the method of assigning requested (calibrated or calculated) level, volume or flow to values measured by the transmitter.

It can be used for instance if the sound velocity is not known (LEVEL  $\rightarrow$  LEVEL) or in the case of tank with other shape than under 6.4 or open channel other than under 6.5 (LEVEL  $\rightarrow$  VOLUME or LEVEL  $\rightarrow$  FLOW).

а	Linearization
0	OFF (FACTORY DEFAULT)
1	ON


#### P48: Linearization table

Data-pairs of the linearization table are handled in a 2 x 32 matrix, consisting of two columns.

Left column "L"	Right column "r"
LEVEL measured	LEVEL or VOLUME or FLOW to be transmitted and displayed

The left column values (indicated on the display as "L") contain the measured LEVEL values.

The right column values (indicated on the display as "r") contain the calibrated values and are interpreted according to the selected measurement value in P01(a).

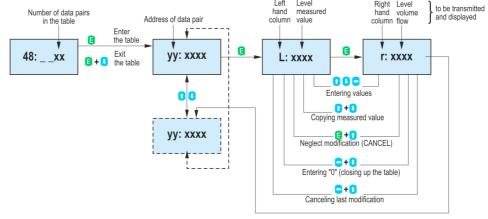

Conditions of correct programming of the data pairs

Left column "L"	Right column "r"
L(1)= 0	<b>r</b> (1)
L(i)	r(i)
:	:
L(j)	r(j)

The table must always start with: L(1)=0 and r(1)= value (assigned to 0 level)

The table must be ended either with the 32<sup>nd</sup> data pair i.e., j=32 or if the linearization table contains less than 32 data-pairs j<32, the table must be closed by a level value "0" e.g., L(j<32) = 0.

The **EchoTREK** will ignore data after recognizing level value "0" with serial number other than "1".

If the above conditions are not met, error codes will be displayed (see chapter: Error Codes).

## 6.10 INFORMATIONAL PARAMETERS (READ OUT PARAMETERS)

P60: Overall operating hours of the unit (h)

Indication varies according to the elapsed time:

Operating hours	Indication form
0 to 999,9 h	xxx,x
1000 h to 9999 h	XXXX
Over 9999 h	x,xx:e meaning x,xx *10e

P61: Time elapsed after last switch-on (h)

P62: Operating hours of the relay (h)

P64: Number of switching cycles of the relay

Indications are the same as in P60.

P64: Actual temperature of the transducer (°C / °F)

P65: Maximum temperature of the transducer (°C / °F)

P66: Minimum temperature of the transducer (°C / °F)


In case of a breaking in the temperature measuring Pt10 element "tErr" will be displayed (See Chapter 7). The transmitter will perform temperature correction corresponding to 20 °C.

#### P70: Number of Echoes / Echo Map

EchoTREK is monitoring the echo conditions.

Entering this parameter will save the actual echo map.

Number, distance and amplitude of these echoes can be read-out one by one.

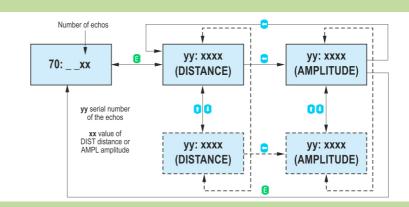

#### P71: Distance of the of Measuring Window (DIST)

P72: Amplitude of the Echo in the Measuring (compared to the ideal echo in dB)

P73: Echo Position (time): [msec]

#### P74: Signal To Noise Ratio

Ratio	Measurement conditions
Over 70	Excellent
Between 70 and 30	Good
Under 30	Unreliable

### P75: Blocking Distance

The actual close-end blocking distance will be displayed (provided automatic blocking was selected in P05).

#### 6.11 ADDITIONAL PARAMETERS OF THE FLOW METERING

P76: Head of flow (Read only parameter) (LEV)

The Headwater value can be checked here. This is the "h" value in the formula for flow calculation.

P77: TOT1 volume flow totalizer (resettable)

P78: TOT2 volume flow totalizer (non-resettable)

## **Resetting TOT1 totalizer:**

- 1). Go to the parameter P77.
- 2). Press NEXT ◆ + DOWN ◆ simultaneously.
- 3). Display will indicate: "t1 Clr".
- 4.) Press ENTER (E) to delete.

#### **6.12 SUPPLEMENTARY PARAMETER OF THE LOGGER**

#### P79: Free space of logger in percent %

If the value is 0, the registry has overflown and every new entry will overwrite the oldest one.

# Clearing the logger

- 1). Enter parameter P79.
- 2). Press 🔸 + 👽 keys.
- 3). The display flashes "Lo-Clr" message.
- 4). Pressing (E) will clear the logger.

#### 6.13 TEST PARAMETERS

#### P80: Current output test (mA)

Going to this parameter, the actual current output (corresponding to the measured process value) will be displayed. By pressing ENTER (E) the (now blinking) current value can be set for any value between 3.9 and 20.5 mA. The current output has to show the same value which can be checked by an ampere meter, according to the description under 4.4. Press ENTER (E) to quit test mode and return the parameter address

Note: The outputs are activated immediately by pressing (E). Testing is terminated when you exit the test parameters

#### P81: ---a Relay test

The actual state of the relay can be seen on the display (code according to the table below and symbol on the screen). Test the relay by pressing UP 
and DOWN while observing change of the symbol and the code or listening to the ticking of the relay or checking on-off resistance by a suitable resistance meter.

а	Relay state
0	De-energized
1	Energized

#### P97: b:a.aa Software code

a.aa: Number of the software versionb: Code of the special version


#### 6.14 SIMULATION

This function enables the user to test the settings of the outputs. The EchoTREK can simulate the static or continuous change of level according to the simulation cycle time, high level and low-level set in P85, P86 and P87. (The simulation levels must be within the programmed measuring range set in P04 and P05.)

After selecting simulation type in P85 and setting simulation values Measurement Mode has to be re-entered. While the EchoTREK is in simulation mode the DIST, LEV or VOL symbol will be blinking. To quit Simulation Mode P84 = 0 should be set.

#### P84: --- x Selection of the simulation

Х	Simulation type					
0	No simulation					
1	The level changes continuously up and down between the level values set in <b>P86</b> and <b>P87</b> with a cycle time set in <b>P85</b>					
2	Simulate a constant level: takes the value specified in P86					

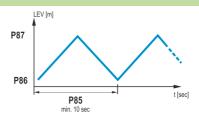

P85: Cycle time for simulation (sec)

P86: Simulated low-level value (m)

P87: Simulated high-level value (m)

#### 6.15 ACCESS LOCK

#### P99: dcba Access Lock by Secret Code

The purpose of this feature is to provide protection against accidental (or intentional) re-programming of parameters.

The Secret Code can be any value other than **0000**. Setting a Secret Code will automatically be activated when the EchoTREK is returned to the Measurement Mode. If the Secret Code is activated, the parameters can only be viewed, this is indicated by a flashing colon ":" between the parameter address and the parameter value.

In order to program the device locked by a secret code, first enter the Secret Code in **P99**. The Secret Code is re-activated each time the EchoTREK is returned to Measurement Mode.

To delete the Secret Code, enter the Secret Code in P99. After confirming it with (E) re-enter the parameter P99 and enter 0000.

[dcba (Secret Code) ]  $\rightarrow$   $\bigcirc$   $\rightarrow$   $\bigcirc$   $\rightarrow$  [0000]  $\rightarrow$   $\bigcirc$   $\rightarrow$  Secret Code deleted

# 7. ERROR CODES

Error Code	Error description	Causes and solutions			
1	Memory error	Contact local agent			
noEcho	Echo loss	No echo received (no reflection) See Action 5 and 6			
3	Hardware error	Contact local agent			
4	Display overflow	Check settings			
5	Sensor error or improper installation/mounting, level in the dead band	Verify sensor for correct operation and check for correct mounting according to the User's Manual			
6	The measurement is at the reliability threshold	Better location should be tried.			
7	No signal received within the measuring range specified in <b>P04</b> and <b>P05</b>	Review programming, also look for installation mistake			
12	Linearization table error: both L(1) and L(2) are zero (no valid data-pairs)	See the Section "Linearization"			
13	Linearization table error: there are two same L(i) data in the table	See the Section "Linearization"			
14	Linearization table error: the r(i) values are not monotone increasing	See the Section "Linearization"			
15	Linearization table error: measured Level is higher than the last Volume or Flow data-pair	See the Section "Linearization"			
16	The check sum of the program in the EEPROM is wrong	Contact local agent			
17	Parameter consistency failure	Check programming			
18	Hardware failure	Contact local agent			

# 8. PARAMETER TABLE

Pr.	Page	Description	'	<b>V</b> alue	)	Pr.	Page	Description		Va	alue	
			d	c b	а				C	Ιc	b	а
P00	28	Application / Engineering Units				P28	38	Echo loss indication		Т	П	
P01	29	Measurement Mode				P29	39	Blocking out of disturbing object		Т	П	7
P02	29	Calculation units				P30		N.A.		Т	П	П
P03	30	Rounding				P31	39	Sound velocity in different gases		Т	П	7
P04	31	Maximum Measuring Distance				P32	39	Specific gravity		Т	П	П
P05	32	Minimum Measuring Distance				P33		N.A.		Т	П	П
P06	33	Far End Blocking				P34	41	Logging mode		Т	П	П
P07		N.A.				P35	42	Log value 1 and log value 2		Т	П	П
P08		N.A.				P36	42	Log value 1 and log value 2		Т	П	П
P09		N.A.				P37	43	Real-time clock, year		Т	П	7
P10	34	Value assigned to "4 mA"				P38	43	Real-time clock, month and day		Т	П	П
P11	34	Value assigned to "20 mA"				P39	43	Real-time clock hour and minute		Т	П	7
P12	34	"Error" indication by the current output				P40	44	Selection of tank shape/ open channel		Т	П	7
P13		Relay function				P41	44	Dimensions of tank / Open Channel		Т	П	7
P14		Relay parameter – Operating value				P42	44	Dimensions of tank / Open Channel		$\mathbb{L}$	П	
P15		Relay parameter – Releasing value				P43	44	Dimensions of tank / Open Channel			П	
P16		Relay parameter – Pulse rate				P44	44	Dimensions of tank / Open Channel		$\mathbb{L}$	П	
P17		N.A.				P45	44	Dimensions of tank / Open Channel		Т	П	
P18		N.A.				P46	50	Dist. Btw. Transducer face and level of Q=0		$\perp$	П	
P19	35	HART short address				P47	51	Linearization		$\perp$	Ш	
P20	36	Damping				P48	51	Linearization table				
P21		N.A.				P49		N.A.		$\perp$	Ш	
P22	36	Dome top tank compensation				P50		N.A.			Ш	
P23		N.A.				P51		N.A.		$\perp$	Ш	
P24	36	Target tracking speed				P52		N.A.		$\perp$	Ш	
P25	37	Selection of Echo in the measuring window				P53		N.A.		L	Ш	
P26	37	Level elevation rate				P54		N.A.		$\perp$	Ш	
P27	37	Level descent rate	Ш			P55		N.A.		L	Ш	

Pr.	Page	Description	Value	Pr.	Page	Description	Value	)
			dcba				d c	b a
P56		N.A.		P78	54	TOT2 volume flow totalizer		
P57		N.A.		P79	54	N.A.		
P58		N.A.		P80	55	Current generator test		
P59		N.A.		P81		Relay test		
P60	52	Overall operating hours of the unit		P82		N.A.		
P61	52	Time elapsed after last switch-on		P83		N.A.		
P62		Operating hours of the relay		P84	56	Simulation mode		
P63		Number of switching cycles of the relay		P85	56	Simulation cycle time		
P64	52	Actual temperature of the transducer		P86	56	Simulation low level		
P65	52	Maximum temperature of the transducer		P87	56	Simulation high level		
P66	52	Minimum temperature of the transducer		P88		N.A.		
P67		N.A.		P89		N.A.		
P68		N.A.		P90		N.A.		
P69		N.A.		P91		N.A.		
P70	53	Echo Map		P92		N.A.		
P71	53	Distance of the measuring window		P93		N.A.		
P72	53	Amplitude of the in the measuring window		P94		N.A.		
P73	53	Distance of the in the measuring window		P95		N.A.		
P74	53	Signal / noise ratio		P96		N.A.		
P75	53	Blocking Distance		P97	55	Software code		Ш
P76	54	Waterhead of the flow		P98		N.A.		
P77	54	TOT1 volume flow totalizer		P99	56	Access lock		

# 9. SOUND VELOCITIES IN DIFFERENT GASES

The following table contains the sound velocity of various gases measured at +20 °C (+68 °F).

Gases	Formula	Sound Velocity (m/s)
Acetaldehyde	C <sub>2</sub> H <sub>4</sub> O	252.8
Acetylene	C <sub>2</sub> H <sub>2</sub>	340.8
Ammonia	NH <sub>3</sub>	429.9
Argon	Ar	319.1
Benzene	C <sub>6</sub> H <sub>6</sub>	183.4
Carbon dioxide	CO <sub>2</sub>	268.3
Carbon monoxide	CO	349.2
Carbon tetrachloride	CCI <sub>4</sub>	150.2
Chlorine	Cl <sub>2</sub>	212.7
Dimethyl ether	CH <sub>3</sub> OCH <sub>3</sub>	213.4
Ethane	C₂H <sub>6</sub>	327.4
Ethanol	SF <sub>6</sub>	137.8

Gases	Formula	Sound Velocity (m/s)
Ethylene	C <sub>2</sub> H <sub>3</sub> OH	267.3
Helium	C <sub>2</sub> H <sub>4</sub>	329.4
Hydrogen sulfide	He	994.5
Methane	H <sub>2</sub> S	321.1
Methanol	CH <sub>4</sub>	445.5
Neon	CH <sub>3</sub> OH	347
Nitrogen	Ne	449.6
Nitrogen monoxide	$N_2$	349.1
Oxygen	NO	346
Propane N.A.	O <sub>2</sub>	328.6
Sulphur hexafluoride	C <sub>3</sub> H <sub>8</sub>	246.5

sea380en2119p August 2021

NIVELCO reserves the right to change technical specifications without notice.